


## NORME DI TARATURA PER BI. 233 A.

- R 1 1000 Ω 2 W
- R 10 1500 Ω 1/4 W
- R 11 1 MΩ 1/4 W
- R 12 5600 Ω 1/2 W
- R 13 1 MΩ 1/4 W
- R 14 150 Ω 1/2 W
- R 15 22000 Ω 1/4 W
- R 16 10000 Ω 1/2 W
- R 17 18000 Ω 1/2 W
- R 18 220 Ω 1/4 W
- R 19 1 MΩ 1/4 W
- R 20 47000 Ω 1/2 W
- R 21 220 Ω 1/4 W
- R 22 1,5 MΩ 1/4 W
- R 23 15000 Ω 1/4 W
- R 24 33000 Ω 1/4 W
- R 25 0,33 MΩ 1/4 W
- R 26 0,1 MΩ 1/4 W
- R 27 0,1 MΩ 1/4 W
- R 28 0,56 MΩ 1/4 W
- R 29 1,8 MΩ
- R 30 0,2 MΩ
- R 31 10 MΩ 1/4 W
- R 32 0,22 MΩ 1/2 W
- R 33 0,68 MΩ 1/4 W
- R 35 180 Ω 1 W
- R 37 0,1 MΩ 1/4 W
- R 38 560 Ω 1/4 W

	Posi- zione	Indice su:	Frequenza taratura	Mezzo e punto d'accop- piamento	Disalli- neare	Regolare	Per
Bobine M.F. A.M.	O.M.	517 KHz	460 KHz	32 KpF su gl UCH 81	S 29 - S 25	S 30 - S 29	uscita
						S 24 - S 25	massima
Bobina filtro M.F. - A.M.				Antenna artificiale		S 4E	uscita minima
Bobina sintonia O.M.	O.M.	517 KHz 1630 KHz	517 KHz 1630 KHz	fra boccola antenna A.M. e massa		S 21 + S 18a C 33 - C 30	uscita massima
Bobina sintonia O.C.	O.C.	5,9 MHz 11,5 MHz	5,9 MHz 11,5 MHz			S 38 - S 40 C 69	uscita massima
Bobine M.F. F.M.	F.M.	87 MHz	10,7 MHz modulato a ±22,5KHz	10 KpF su gl UCH 81	S 23 + S 28	S 26 - S 22	Max RV
						S 23 - S 28	usc. max
Bobina filtro F.M. M.F.						S 17	S 16 - S 17
(*) Bobine sin- tonia F.M.		100 MHz 87,5 MHz	100 MHz 87,5 MHz	Adattatore simmetrico da 300 Ω alle boccole del dipolo		C 9 S 15 - S 13	uscita massima

- C 1 50 μF 285 V
- C 2 50 μF 285 V
- C 3 22000 pF
- C 4 10000 pF
- C 5 1500 pF
- C 6 10000 pF
- C 9 3+30 pF
- C 10 2,5+14,5 pF
- C 11 2,5+14,5 pF
- C 12 12+490 pF
- C 13 12+170 pF
- C 14 4700 pF
- C 15 47 pF
- C 16 47 pF
- C 17 47 pF
- C 18 47 pF
- C 19 220 pF
- C 20 3+30 pF
- C 21 18 pF
- C 22 1000 pF
- C 23 1000 pF
- C 24 400 pF
- C 25 18 pF
- C 26 15 pF
- C 27 3000 pF
- C 30 3+30 pF
- C 31 10000 pF
- C 32 10000 pF
- C 33 18 pF
- C 34 470 pF
- C 35 100 pF
- C 36 39 pF
- C 37 15 pF
- C 38 15 pF
- C 39 110 pF
- C 40 195 pF
- C 41 1500 pF
- C 42 47000 pF
- C 43 5,6 pF
- C 44 10000 pF
- C 45 39 pF
- C 46 110 pF
- C 47 195 pF
- C 48 10000 pF
- C 49 56 pF
- C 50 330 pF
- C 51 330 pF
- C 52 1500 pF
- C 53 5 pF
- C 54 2200 pF
- C 55 4700 pF
- C 56 1200 pF
- C 57 10000 pF
- C 58 22000 pF

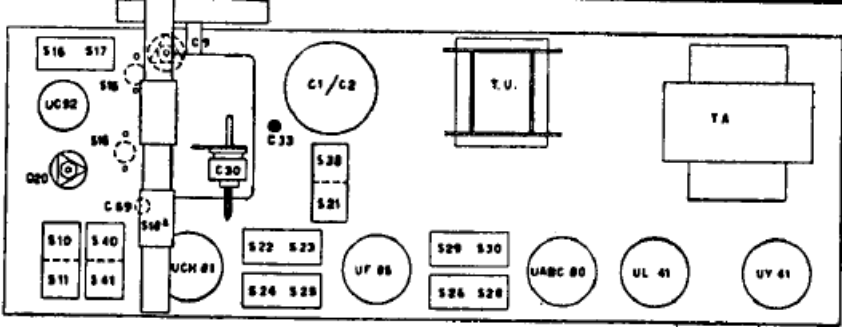

### TENSIONI E CORRENTI CON ALIMENTAZIONE 220 V. 50 Hz

1) Posizione commutatore F. M.

Valvole	Va	Vg2-4	Vg1	VK	Ia mA	Ig2-4 mA	Vf
B1 UC 92	120		a) - 2,2		6,1		9
B2 UCH 81	150	100		Triodo	0		18
				Eptodo	6,7	6,2	
B3 UF 85	150	60	a) - 0,6	0	9,3	1,1	18
B4 UABC 80	51		a) - 0,8	0	0,32		28
B5 UL 41	173	150	a) 0	8,9	43,8	8,2	43
B6 UY 41	176			189	83		34

Vc1	Vc2	I tot	W	V.A.	I prim.	V tot. fil.
189	150	83	39	48,4	220	116

S 1	Sp. 70	S 16	1a M.F. per F.M.	S 20	2a M.F. per A.M.
S 2	Sp. 1016	S 17		S 30	
S 3	Sp. 224	S 18	Ferroceptor per O.M.	S 31	Sp. 2400
S 4	Sp. 183	S 18a		S 32	Sp. 90
S 5	Sp. 155	S 20	oscillatore per O.M.	S 33	Sp. 97
S 6	Sp. 267	S 21		C 35	Bobina di equilibrio
S 7	Sp. 350	S 22	2a M.F. per F.M	S 35a	Bobina oscillatore per O.C
S 10	Filtro M.F. per F.M.	S 23		S 37	
S 11	Bobina antenna F.M.	S 24	1a M.F. per A.M	S 38	
S 12		S 25	Rivelatore a rapp.	S 39	
S 13	Bobina oscillatore F.M.	S 26		S 40	Bobina ant. O.C. + filtro M.F. per A.M.
S 13a		S 27	S 41		
S 14	S 28	S 42			
S 14a	S 28a				
S 15					
S 15a					